

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-022367**Date Inspected:** 26-Mar-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 1500**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 300**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China

CWI Name:	Mr. Geng Wei		
Inspected CWI report:	Yes	No	N/A
Electrode to specification:	Yes	No	N/A
Qualified Welders:	Yes	No	N/A
Approved Drawings:	Yes	No	N/A

CWI Present:	Yes	No
Rod Oven in Use:	Yes	No
Weld Procedures Followed:	Yes	No
Verified Joint Fit-up:	Yes	No
Approved WPS:	Yes	No
Delayed / Cancelled:	Yes	No

Bridge No: 34-0006**Component:** OBG Segment Assembly**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Ramesh Gade, was present during the times noted above for observations relative to the work being performed.

OBG Segment 13BE / Bay 14

This QA inspector performed Ultrasonic Testing (UT) approximately 10% of the area that has been previously tested and accepted by ZPMC Quality Control (QC) personnel. This QA Inspector generated UT report for this date. The member is identified as OBG Segment 13BE welds as per ZPMC notification # 08640.

The weld designations reviewed are as follows:

SEG3009H-067, 068, 072, 073, 077, 078, 082, 083, 087, 088, 092, 093, 097, 098,
102, 103, 107, 108, 112, 113, 117, 118, 122, 123, 127, 128, 132, 133,
137, 138, 142, 143, 147, 148, 152, 153

SEG3009F-130, 134

OBG Segment 14E / Bay 14

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 4G position of SA to AP weld # SEG3019BB-089. The welder is identified as 216086. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-TC-U4b-FCM-1.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 4G position of SA to AP weld # SEG3019BB-133. The welder is identified as 215553. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-TC-U4b-FCM-1.

OBG Segment 14E / Bay 14


This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 4G position of SA to AP weld # SEG3019BB-155. The welder is identified as 044779. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-TC-U4b-FCM-1.

OBG Segment 14E / Bay 14

This QA Inspector observed the following work in progress:

Shielded Metal Arc Welding (SMAW) in the 4G position of SA to AP weld # SEG3019BB-177. The welder is identified as 054013. Quality Control (QC) is identified as Xie Ming Feng. The welding variables recorded by QC appeared to comply with WPS-B-P-2214-TC-U4b-FCM-1.

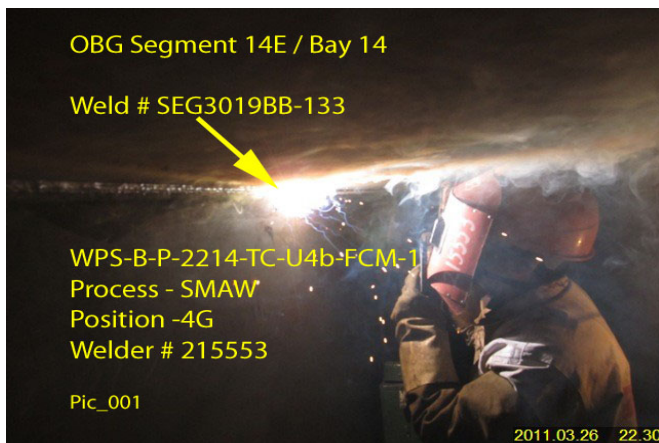

Summary of Conversations:

No relevant conversations reported on this date.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang (+86)15000 42 2372, who represents the Office of Structural Materials for your project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Inspected By:	Gade,Ramesh	Quality Assurance Inspector
----------------------	-------------	-----------------------------

Reviewed By:	McClendon,Timothy	QA Reviewer
---------------------	-------------------	-------------
